

Return & Repair Form:

10514 109  
80479579

Customer Information:

Company Name: NS State Police B: \_\_\_\_\_ S: \_\_\_\_\_  
 Date Received: 11-3-09 Date Given to Service: \_\_\_\_\_  
 Carrier: FedEx - UPS - DHL - USPS Method: GRD - NDA - 2DY - 3DY - Other

Product Information:

Product: 7410-7110-6510-6810-7510 Serial #: AR WE -0031  
 9510- Drug Tester 5000  
 Description: A - B - Plus - Screener - Demo Printer Ser #: AR -  
 Whole Instrument Top 1/2 Sim Ser #: \_\_\_\_\_  
 Other \_\_\_\_\_ Probe Ser # DD P -  
**ACCESSORIES:**  
 110 V A/C Adapter  Regulator  Mag Card Rdr# \_\_\_\_\_  
 Printer Paper  Printer Ribbon  Casio # \_\_\_\_\_  
 Mouthpieces  Carrying Case  Dry Gas  
 Other (Please Specify) \_\_\_\_\_ Warranty Exp. Date \_\_\_\_\_

Repair Information:

Test #

Reason for Return: Flow sensor followed by ERROR 41  
ERROR 23

Part Number	Description	Qty	Total Cost
<u>8100902</u>	<u>FLOW SENSOR</u>	<u>1</u>	<u>N/C WARR</u>
<u>MP CAL 41</u>	<u>CAL</u>	<u>1</u>	<u>N/C WARR</u>
<u>12111</u>	<u>THERMAL FUSE</u>	<u>1</u>	<u>N/C WARR</u>
<u>8315075</u>	<u>PCB</u>	<u>1</u>	<u>N/C WARR</u>
<u>MM Labor</u>	<u>Labor</u>	<u>.5</u>	<u>N/C WARR</u>

Repair Notes:

Installed FLOW SENSOR, BLEW OUT CUVEtte with air,  
INSTALL NEW THERMAL FUSE (TO CLEAR ERROR 23)  
CLEAR ERROR (41)  
REPLACED PCB - STEVED. NOTED THAT THERE SHOULD HAVE BEEN 40+ AIR'S  
SINCE THE FLOW SENSOR WAS OPEN, THE T-FUSE WAS OPEN  
AND DATA MAY BE MISSING, WE DECIDED TO REPLACE THE MAIN PCB.  
AS PREVENT. MAINT.  
CAL WI QC AND OPS CHECKS

Service Technician: JS

Date: 11/10/09