

Return & Repair Form:

10314109  
80479579

Customer Information:

Company Name: NS State Police B: \_\_\_\_\_ S: \_\_\_\_\_  
 Date Received: 11-3-09 Date Given to Service: \_\_\_\_\_  
 Carrier: FedEx - UPS - DHL - USPS Method: GRD - NDA - 2DY 3DY Other

Product Information:

Product: 7410-7110-6510-6810-7510 Serial #: AR WE -0031  
 9510-Drug Tester 5000  
 Description: A - B - Plus - Screener - Demo Printer Ser #: AR -  
 Whole Instrument Top 1/2 Sim Ser #: \_\_\_\_\_  
 Other \_\_\_\_\_ Probe Ser # DD P -  
**ACCESSORIES:**  
 110 V A/C Adapter  Regulator  Mag Card Rdr# \_\_\_\_\_  
 Printer Paper  Printer Ribbon  Casio # \_\_\_\_\_  
 Mouthpieces  Carrying Case  Dry Gas  
 Other (Please Specify) \_\_\_\_\_ Warranty Exp. Date \_\_\_\_\_

Repair Information:

Test #

Reason for Return: Flow SENSOR ERROR 41  
followed by ERROR 23

| Part Number | Description  | Qty | Total Cost |
|-------------|--------------|-----|------------|
| 8100902     | FLOW SENSOR  | 1   | N/C WARR   |
| MP CAL 41   | CAL          | 1   | N/C WARR   |
| 12111       | Thermal FUSE | 1   | N/C WARR   |
| 83/5075     | PCB          | 1   | N/C WARR   |
| MP Labor    | Labor        | .5  | N/C WARR   |

Repair Notes:

Installed FLOW SENSOR, blew out cuvette with air.  
 Install new Thermal FUSE (to clear error 23)  
 Cleared ERROR 41  
 Replaced PCB - STEVED. NOTED THAT THERE SHOULD HAVE BEEN 40+ AIR'S  
 SINCE THE FLOW SENSOR WAS OPEN, THE T-FUSE WAS OPEN  
 AND DATA MAY BE MISSING, WE DECIDED TO REPLACE THE MAIN PCB.  
 AS PREVENT. MAINT. ✓  
 CAL w/ QC AND OPS CHECKS

Service Technician: JS

Date: 11/10/09